

USN3. POPE.

1. SMOKE DETECT. SYSTEM: RENEW (3) 3' FLANGED PIPE FITTINGS THRU WHEELHOUSE TOP TO BLOWER MOTOR ENCLOSURE.
 ✓ CLEAR LINES BETWEEN, CARPENTER SHOP & PLUMBER SHOP, AND BRIDGE SMOKE DETECTING CABINET.
2. FAN ENCLOSURE 04-94-2 E, RENEW ENCLOSURE & FOUNDATION $20\frac{1}{2}" \times 25\frac{1}{2}" \times 26"$ W/ HINGED TOP & 2 VENT PENETRATIONS (1 - 12" DIA.) & (1 - 10" X 11") CLEAN & BALANCE MOTOR & IMPELLER
3. RENEW APPROX 50% CABLE HANGERS ON RADAR CABLE ON RADAR MAST APPROX. 20 HANGERS.
4. RENEW COVERS & GASKETS P/S BRIDGE WING INTERCOMM. UNITS - APPROX. MEAS. 13" X 16 $\frac{1}{2}"$ & HINGED.
5. CROP OUT DETERIORATED SECTION OF HOUSE 03-94-2 (RADIO OFFICERS ROOM) INSERT NEW SECT, 24" X 75" X $\frac{1}{4}"$
6. RENEW ENTIRE TOP DECK OF OUTER STACK #1
 PLUG WELD HOLE AT BASE OF #1 STACK FWD, STRD. SIDE.
 RENEW HANGERS ON DIESEL OIL VENT LINES #1 STACK (STAGING NECESSARY)

7. RENEW BATTERY STORAGE BOX OVER CHART TABLE

APPROX. DIMENSION 21" X 12" X 12".

REMOVE OR PROPERLY INSTALL EXISTING FLOURESANT LIGHT OVER CHART TABLE REMOVE BOOT LEGGED ELECT SUPPLY CABLE FROM INTERCOM TO SUBJECT LIGHT & SECURE POWER FROM AN APPROVED & PROPER SOURCE.

8. INSTALL SCREENS ON VENT SUPPLY OUTLETS (3)

S-1-95-2 (GYRO. ROOM)

9. APPROX 2 SQ. FT. OF MAG & TILE DECK REPAIR

IN NEU. PATIENT WARD (HOSP. SPACES).

INSTALL LOCKING DEVICE ON BOOK CASE & CENTER DECK DRAWER & RENEW DECK LAMP - DOCTORS OFFICE.

10. GARBAGE DISPOSAL, OUTSIDE BAKE SHOP, IS INOPERATIVE

IN DISREPAIR & IN AN ADVANCED STATE OF INTERIOR DETERIORATION - REMOVE IT (NOT USED FOR ANYTHING)

PORT SIDE AFT REEFER BOX IN BAKE SHOP NEEDS AUTO-CONTROLLER SWITCH RENEW/DOOR REPAIRED.

11. CARDENTER SHOP, RENEW VENT SCREEN & REPAIR RUSTED

OUT SECTION (APPROX. 6" X 12") NAT. SUPPLY PORT SIDE.

HEATER MISSING IN ITS ENTIRETY - INSTALL NEW ONE. OVERHAUL VALVING STEAM SUPPLY & RETURN TO SUBJECT HEATER.

12. FWD DECK LOCKER STAR SIDE. REMOVE WOODEN SHELVING & INSTALL METAL SHELVING. REPAIR VENT? RPE APPROX. 2" I.D. @ AFT. BHD. PENETRATION.
13. FORE PEAK. CLEAN RIDGE WELLS & RENEW APPROX. 10" EA. P/S SUCTION LINE & INSTALL STRAINERS.
14. FAN ROOM #8 REPAIR GASKET CHANNEL AT BOTTOM OF DOOR & RENEW GASKET, REPAIR HOLE, APPROX 1 1/2" DIA. @ APPROX FRAME 186 PORT THRU BHD NEAR PUMP ROOM VENT DUCT.
15. RENEW SPRINGS & HOLDERS, PUMP ROOM HATCH MAIN DECK FR. 186-2-E
16. RENEW APPROX. 60' SUPPLY DUCTING #1 E.R., 4TH DECK PORT SIDE FRAMES 103-114 (S-02-10'8-4)
17. RENEW RETURN HEADS # 1 1/2 S.S. GEN. CONDENSERS. RENEW COVER PLATE OVER INLET-OUTLET HEADS # 1 1/2 S.S. GEN. CONDENSERS.
18. INSTALL AN EXH. VENT SYSTEM TO TIE INTO EXISTING LAUNDRY EXH. ~~IN~~ IN EVAP. FLAT. NO EXH. SYSTEM IS PRESENTLY INSTALLED IN EVAP.

18. (CONT'D) FLAT. WITH HEAT FROM EVAP UNITS (2) FUEL OIL SETTLING TANKS (4) & FUEL OIL DOUBLE BOTTOM STORAGE TANKS, THIS AREA BECOMES NEAR UNTENABLE IN NORTHERN WATERS & TEMP. RANGES NEAR 150°F TO 160°F IN TROPICAL & SUB-TROPICAL AREAS.

RENEW VENT SUPPLY TERMINAL COMPLETE W/ SCREEN & DAMPER LOWER EVAP. FLAT.

19. INSTALL EXHAUST VENT DUCT OVER WELDING BENCH IN WELDING SHOP - TIE INTO PROPOSED EVAP FLAT EXH. VENT DUCTING (SEE ITEM 18)

20. RENEW WATER HEATER IN #2 ENG. ROOM. SUGGEST THE FLASH TYPE HEATER.

21. RENEW APPROX. 50' OF 2" STEAM HEATING RETURN LINE 3-82-1 - 1 BHD PENETRATION & 1 - 1/2" OFFSTICKER. 40' AFT BHD 82 & 10' FWD OF BHD. 82 - WELDED.