

USNS GENERAL JOHN POPE (T-AP110)
FLEET POST OFFICE
SAN FRANCISCO, CALIFORNIA

INDEX - ADDENDUM #1 VOYAGE REPAIR LIST - VOYAGE #7

<u>Item No.</u>	<u>Subject</u>
21.	Piping, Sanitary Branch Line, Repair of
22.	Adding Machine, Repair of
23.	Typewriter, Repair of
24.	Plunger Rods, Bridge Telemotor, , Repacking of
25.	Governor Assembly, Ships Service Generator, Repair of.
26.	Governor, Ships Service Generator #2, Repair of.
27.	Pipe, Fire Main, Renewal of.

USNS GENERAL JOHN POPE (T-AP110)
FLEET POST OFFICE
SAN FRANCISCO, CALIFORNIA

ADDENDUM #1 TO VOYAGE REPAIR LIST - VOYAGE #7

SUBMITTED 
E. C. QUINN, CH. ENGR.

APPROVED 
G. W. BERLIN, MASTER

Item No.	Priority	Subject and Description
(21)	3	<p>SUBJECT: Piping, Sanitary Branch Line, Renewal of</p> <p>LOCATION: 2-16-0-L</p> <p>CONDITION: Deteriorated and leaking</p> <p>QUANTITY: One (1) 2" Galv. Pipe 5' long, flanged at one end and welded at other</p> <p>RECOMMEND: Furnish labor and material to remove existing section and reinstall new section so that it does not make physical contact with exhaust duct.</p>
(22)	3	<p>SUBJECT: Adding Machine, Repair of</p> <p>DATA: Remington-Rand Serial 3N1744276</p> <p>LOCATION: Purser's Office</p> <p>CONDITION: Machine is presently operating but "Gallops"</p> <p>QUANTITY: One (1)</p> <p>RECOMMEND: Furnish labor and material to repair and clean. Repair aboard ship if possible.</p>
(23)	3	<p>SUBJECT: Typewriter, Repair of</p> <p>DATA: Underwood "Five" Serial 11-7183127</p> <p>LOCATION: Deck Yeoman's Office</p> <p>CONDITION: Carriage broken and keys stick</p> <p>QUANTITY: One (1)</p> <p>RECOMMEND: Furnish labor and material to clean, adjust and repair as required.</p>

Item No.	Priority	Subject and Description
(24)	3	<p>SUBJECT: Plunger Rods, Bridge Telemotor Repacking of</p> <p>DATA: Mfg. Beacon</p> <p>LOCATION: Bridge</p> <p>CONDITION: Air leaking into Telemotor System causing frequent loss of system.</p> <p>QUANTITY: One (1)</p> <p>RECOMMEND: Furnish labor and material to repack plunger rods and check entire system for possible air leaks.</p>
(25)	3	<p>SUBJECT: Governor Assembly, Ships Service Generator Repair of</p> <p>DATA: Mfg. DeLavel Steam Turbine Corp. H.P: 580, SPEED: 9977 RPM, SER.: 236632</p> <p>LOCATION: Forward Engine Room</p> <p>CONDITION: Scored power piston rod and upper bushing unable to adjust to correct speed without excessive hunting.</p> <p>QUANTITY: One (1)</p> <p>RECOMMEND: Furnish labor and material and renew parts as necessary to place unit in Mfg. designed condition for immediate use.</p>
(26)	3	<p>SUBJECT: Governor, Ships Service Generator #2, Repair of.</p> <p>DATA: Mfg.: DeLavel Steam Turbine Corp. H.P.: 580, SPEED: 9977 RPM, SER.: 236632</p> <p>LOCATION: Forward Engine Room</p> <p>CONDITION: Scored power piston, piston rod, cylinder and piston rod bushing upper</p> <p>QUANTITY: One (1)</p> <p>RECOMMEND: Furnish labor and material and renew parts as needed. Test operate to satisfaction of Chief Engineer.</p>

Item No.	Priority	Subject and Description
(27)	3	<p>SUBJECT: Pipe, Fire Main, Renewal of</p> <p>DATA: 2$\frac{1}{2}$"</p> <p>LOCATION: 2-106-2 (Fiddley)</p> <p>CONDITION: Deteriorated</p> <p>QUANTITY: One (1) 2$\frac{1}{2}$" x 24" Flanged section. One 90 Deg. bend.</p> <p>RECOMMEND: Furnish labor and material and renew. (Remove deteriorated section and use as template.)</p>