

American Bureau of Shipping

45 BROAD STREET, NEW YORK 4, N. Y.

(THIS FORM IS TO BE USED IN CONFIRMATION OF CLASS ONLY.)

Report No. 11,358

San Francisco, Calif., May 22, 1951

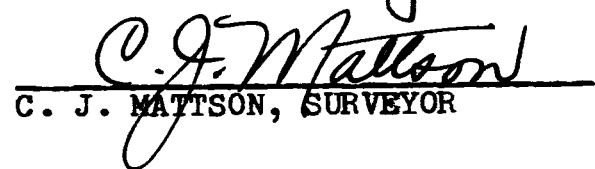
S.S. "GENERAL JOHN POPE"

THIS IS TO CERTIFY that the undersigned Surveyors to this Bureau did, at the request of the owner's representative, attend the twin screw steel steamer "GENERAL JOHN POPE" on the 21st day of May, 1951 and subsequent date, as vessel lay afloat at Intransit Depot, Alameda, and Fort Mason, San Francisco, California, in order to examine boiler repairs. For further particulars see report as follows:

1. Wasted fittings on the desuperheated steam line outlets in the drums of the Nos. 1, 2, 3 and 4 boilers were renewed.
2. Two superheater tube supports and brackets in the top half of the upper section of No. 4 boiler found burnt and deteriorated were removed and renewed together with five superheater elements. Upon completion of repairs, No. 4 boiler was tested hydrostatically and found tight.
3. The new superheater elements were stated to have been tested per Pittsburgh Report No. 51-3625-80 dated April 30, 1951.

It is recommended that this vessel be retained in present classification with this Bureau.


B. KURTZ, SURVEYOR


C. J. MATTSON, SURVEYOR

This Report is issued subject to the condition that it is understood and agreed that neither the Bureau nor any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by this Bureau or its Surveyors or in any entry in the Record or other publication of the Bureau or for any error of judgment, default or negligence of its Officers, Surveyors or Agents.